 




ENGINE LOG BOOK FOR ROTAX® 2-STROKE AND 4-STROKE AIRCRAFT ENGINES



Base record:

0	Engine log book number:	1	for piston engine					
	Type of engine: 912	Model: 152 Sport	Engine serial no.: 7704659					
	Manufacturer: BRP-Rotax GmbH &	Co KG, 4623 Gunskirchen, Austria	Year of manufacture:					
	Data sheet:							
	Take off power:kW/Hp	. perm. duration:	minat	r.p.m.				
	Max. cont. power:kW/Hp	. atr.p.n	n.					
	Note: The above mentioned engine is consider the Civil Aircraft and Civil Aviation Equ instructions.							
	Remarks:							
23.fm	Date:	çi	gnature:					
p			gilatule.					

0.50

Engine installation record:

Aircraft:		Date:		Engine hours:		Signature &	
Registr.:	type:	in:	out:	TSN	TSO	Licence no.:	
Airo Airo Pro 1) 2) 3) 4)	te: 29 May 2021 craft Make: VANS craft Engine: ROTAX opeller: Sensenich Initial Rotax 912iS st Completed Rotax Ser Verified hydraulic tap Reviewed all Rotax 9 nn Dierks PP #331573	art up. rvice Informati pets for prope 12iS service b	SPORT de Ground Adj on Bulletin SI- r purge, All tag	SN: 7 ustable SN: S 912 i-004R2 Pu	od	Engine Hrs: 0.3 Prop Hrs: 0.3 em for Rotax 912 Series.	

SB-status and modification record:

Airworthiness directive or modification:	Date:	Signature & Licence no.:
MARCH 20, 2019 - ASB-912 i-010iS - COMPLIED WITH INSPECTION OF FUEL 889697 S/N 18 0656 FOR LEAKAGE IAW ASB 912 i-010 PARA. 3), 3.2) NO LEA		Kunth A and 325 794
NAN'S AVIRCRAFT SD 19-12-03 FUL PUMP ASSEMBLU ROTAX ASB-912 1-0111 LS R1 REPLACEMENT COMPL NEW FUEL PUMPS S/N 19,5656 AND 19,5673 REPACED FUEL DUMPS	ETE 1/11/2020	GARRET LADE 2723128
NEW FUEL PUMPS 5/N 19.5656 AHD 19.5673 REPLACED FUEL PUMPS 5/N 18.0656		
		M

a second second

-

THE OWNER OF

Maintenance record:

	Engine hours:		Work parformed	Signature &	
Date:	TSN:	TSO:	Work performed:	Licence no.:	
7/16/22	50.1 Hobbs		I certify that this engine has been insp	acted on July 16 2027	
			IAW the Manufacturer's 100 hr inspect		
			procedures and was found to be in a		
			safe operation. oil was changed a	nd serviced w/ Aerospeil	
			Sport plus 4 and new tempest filter.		
			leak checked OK.	El Chury Apy 2812465	
Hobbs :			I certify that this Engine has been inspe		
			s 100hr maintenance and inspection proced ne following operator completed items were		
			vith new parts per checklist and MM procedu		
— liters A	eroshell sport+	-4checked O	K. El Chimul A&P 28	312465 —	
		3		()	

Maintenance record:

	Engine hours:			Signature &	
Date:	TSN:	TSO:	Work performed:	Licence no.:	
Reg: N Eng M Oil Ch Remov BRP R engine Mainte	1107TF Make ake: ROTAX I ange: ed Cowl. inspecte OTAX oil filter P/N cowl. Leak check mance performe	Model: 912is S ad for leaks. Drained 825016. Serviced is good.	C. Model: 912is S/N: 121142 S/N: 7704659 Hobbs: 2229 d oil and removed old oil filter and installed new engine with 2.5 quarts Aeroshell Sport +4 oil, Reinstalled Maintenance manual [Ling maintenance] Engine type 9	12i series.	
Reg: N107TI Eng Make: F Engine: Ani Removed an installed new Check magn #1 79/80 #2 - (SB-00088 I certify this Maintenanc determined	Make: VA ROTAX Model: nual Condition In d reinstalled eng of oil filter P/N 8250 etic plug, Remove 77/80 #3 77/80 Rev 2), Inspected engine has been e manual [Line m to be in airworth	912is S/N: 77046 ispection. cowl. Removed oil fi 016, and serviced with and inspected and #4 78/80. Download Radiator for fatigue in inspected IAW Min- maintenance] Engin	Model: 912is S/N: 121142 59 Tach: 178.4 Hobbs: 239.4 ilter drained oil, inspected filter no defects noted, ith 3 quarts of sport plus 4 aero shell oil. reinstalled spark plugs. Compression check if the ECU fault memory. No fault noted, e cracks and leaks, No defects noted. anufactures Annual inspection schedule and IAW Rotax he type 912i series And IC 43 13 appendix D and was		

- 68





ROTAX® authorized distributor

Engine serial no.

Type of aircraft

Aircraft registration no.

WWW.FLYROTAX.COM



This product is from nably manager ests and controlled

KO O 2017 DDD Deter Orbb C Co KC All rights recorded