


YEA
20
DAT

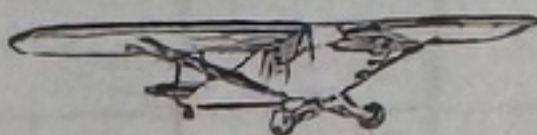

Steve's Aircraft, 15373 Jones RD, White City OR 97503

September 26, 2025

Tach: 140.1

Total Time: 429.7SMOH

N8287B

Piper PA-18-150

18-7609048

Lycoming 0-360-A1A

S/N L-1607-36

1-	77
2-	78
3-	78
4-	78

Removed engine and performed AD 2004-10-14. Replaced crankshaft gear bolt and lock plate. Re-assemble with new gaskets. Re-Installed with new engine mount rubber. Perform annual inspection in accordance with FAR 43 Appendix D. Clean gap and service spark plugs. Install new Tempest 48108-2 oil filter and fill 8qt Phillips oil. Check overall installation for security and installed components.

I certify this engine has been inspected as per annual inspection and determined to be in an airworthy condition and returned to service.

Brian J. Pankonin A&P3102250IA

BJP Oct 14. 2025