

ENGINE ; Prop
in stall

2-20-02

TACH 301.0

The Standard
 AIRCRAFT LOG

ASA-SA-2

SERVICEABLE

Pertinent details of the exhaust system component repairs are on file at this repair station under:

Name Burlington Air Ctr.

Work Order No. 79987

Date 3-7-3

Inspected by Keith A. John

Dawley Aviation

140 Industrial Dr.
Burlington, WI 53105

1-800-338-5420

FAA CRS No. NJ5R069N

SERVICEABLE

Part No. C295001-0304

Serial AA000846

...ve was completely overhauled in accordance with ...d with the current Regulations of the Federal ...ved for return to service.

are on file at this repair station under

Dan Man

(Signature of Authorized Individual)

SYSTEMS, INC.
Visalia, CA 93292

tion #MAMR190K • FAX (559) 627-1960

FAA FOREIGN AIRWORTHINESS U.S. DEPARTMENT OF

UNITED STATES

Aircraft Record General Information

Manufacturer Cessna

Model TR 182

Serial 18201474

Registration Number N326AM

Date of Manufacture _____

Engine(s) currently installed:

Manufacturer _____

Model _____

Serial _____

Manufacturer _____

Model _____

Serial _____

Propeller(s) currently installed:

Manufacturer _____

Model _____

HUB Model _____

Serial _____

Serial _____

Blade Model _____

Serial _____

Serial _____

Serial _____

Blade Model _____

Serial _____

Serial _____

Serial _____

DATE

19

TOTAL
TIME IN
SERVICE

Current Weight and Balance Information

Empty Weight

Empty C.G.

Useful Load

Remarks

*Lumanair, Inc.**Aurora Municipal Airport**Sugar Grove, IL*

Weighed aircraft IAW Cessna Model TR182 flight manual procedures.

Aircraft Basic Empty Weight: 2007 lb.

Aircraft Basic Empty Moment: 75944.8 in. lb.

Aircraft Basic Empty C.G: 37.8"

Useful Load: 1093 lb.

Note: Aircraft Basic Empty Weight includes unusable fuel and full oil. Oxygen bottle was not installed at time of weighing.

Lumanair, Inc. FAA Certified Repair Station # CGFR811C

Kenneth R. Gies

Date 7/30/99 Work Order # 18330 Tach 0000.1 Total Time 1843.5

DATE 19 _____	RECORDING TACH TIME	TODAYS FLIGHT	TOTAL TIME IN SERVICE	Description of Inspections, Tests, Repairs and Alterations Entries must be endorsed with Name, Rating and Certificate Number of Technician or Repair Facility. (See back pages for other specific entries.)
------------------	---------------------------	------------------	-----------------------------	---


Air West Flight Center Inc.

Longmont Colorado

Date 02-08-2006 Tach – 656.1 N326AM

Removed Edo-Aire artificial horizon P/N 23-501-017, S/N A5713. Installed Sigma-Tek artificial horizon P/N 23-501-031-1, S/N T86699E. Ground run-up and operational checks good. No change in weight and balance

C.R. Banner A&P 523044716

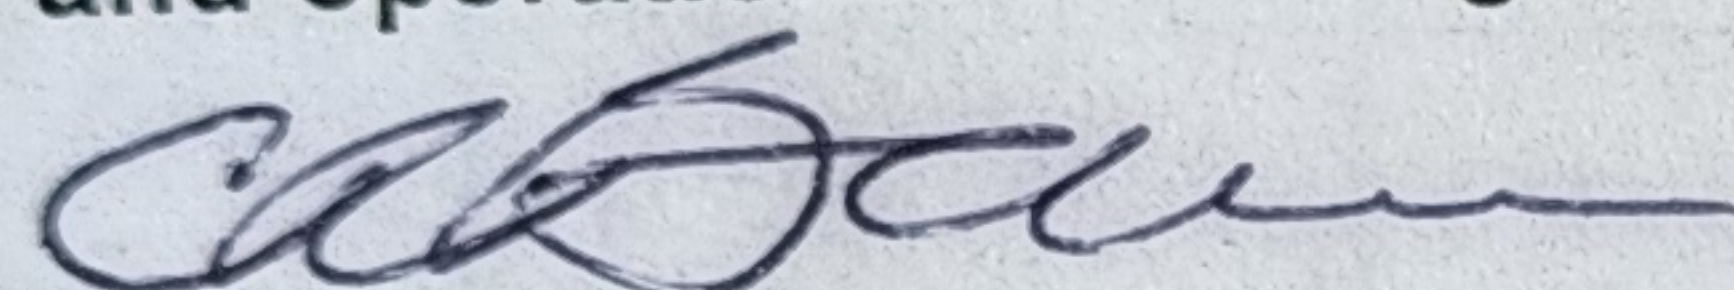

14 MAR 2006 - Log Book closed & ADLOG System opened this Date
TACH 659.3 - TT AIRPORT 2502.7
10 ADLOG 2547.3 SEE ANNUAL INSPECTION
A&P 2052200


DATE	RECORDING TACH TIME	TODAYS FLIGHT	TOTAL TIME IN SERVICE	Description of Inspections, Tests, Repairs and Alterations
19				Entries must be endorsed with Name, Rating and Certificate Number of Technician or Repair Facility. (See back pages for other specific entries.)

Air West Flight Center Inc.

Longmont Colorado

Date 09-21-2005 Tach – 609.9 N326AM

Replaced (6) valve cover gaskets with P/N's SLR 75906. Tightened oil dipstick tube at crankcase, and B nut on dipstick tube. Run-up and leak check ok.

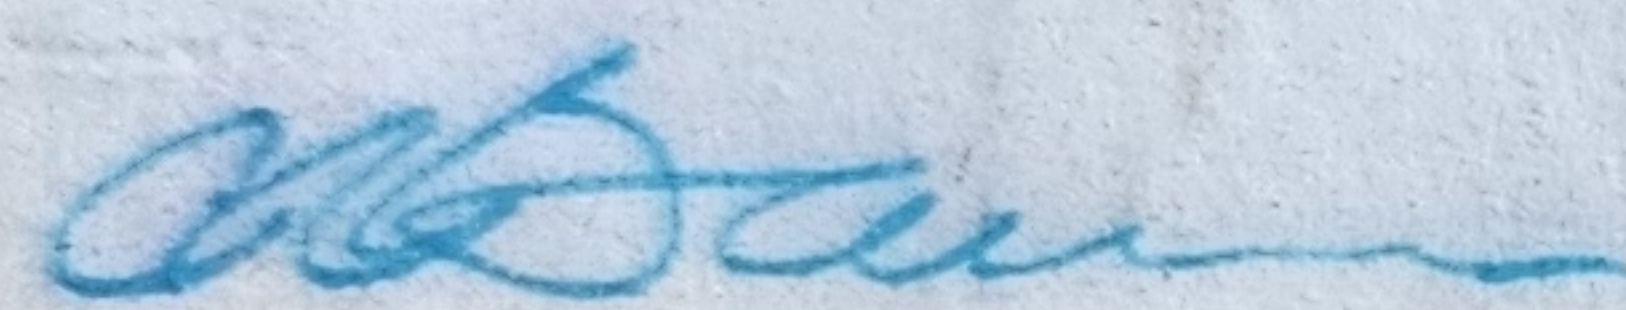

C.R. Banner A&P 523044716

Air West Flight Center Inc.

Longmont Colorado

Date 09-21-2005 Tach – 609.9 N326AM

Adjusted pilot's door latch to over-center to stay in locked position. Tightened middle nose gear torque link attachment. Checked shimmy dampener, ok. Rotated nose gear tire. Replaced LH, outboard elevator static wick.



C.R. Banner A&P 523044716

Air West Flight Center Inc.

Longmont Colorado

Date 10-11-2005 Tach – 614.1 N326AM

Drained oil and replaced oil filter with P/N ES48103. Filter check ok. Serviced with 8 q 15W-50. Run-up and leak check good.



C.R. Banner A&P 523044716