



PROPELLER LOGBOOK

BEECH
V35B
"BANANZA"

13.3° LOW
pitch
X
29.4° HIGH
pitch
X

Owner Name _____

Address _____

Propeller Model 3A32C76.S.Q.R

Blade Model S.82NB-2

Hub Serial No. 881373

Blade Serial No. 1 PB041ys

2 PB043ys

3 PB063ys


4 _____

INSTALLATION HISTORY

Date	Aircraft Model & Registration Number	Engine Serial Number & Position

3

MAINTENANCE & SERVICE HISTORY

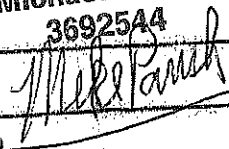Date	Total Propeller Time	Time Since Overhaul	Description of Work	Authorized Signatures Repairman and Station Certificate Numbers
6/8/22		"0"	Propeller completely overhauled AW 720415 Rev. 6, BOM100 Rev. 11 and SPM100 Rev. 8 Service Manuals All A.D.'s, S/B's, S/L's complied with to date. Pertinent details of this overhaul are on file under W.O. 022-225 at the following repair facility: Johnson Propeller Ent., Inc. 211 Aviation St. hgr 104 Shafter, CA 93263 661-399-2480 FAA CRS# J3PR491J	Michael Parish 3692544 

Note: Enter Compliance With All Applicable FAA A.D. & Factory Service Bulletins On Pages 11 & 12

07/23/2022 Hobbs1363.7 Tach 3983.0 TSPOH 0

Annual Inspection Completed: Inspected and installed O/H McCauley Propeller with 3A32C76/S82NB-2 s/n 881373.
See enclosed documents.

I Certify that this Propeller has been inspected in accordance with an Annual inspection and was determined to be in **Airworthy** condition

James M. Chrestensen III
AP 3507385 IA

James M. Chrestensen III

Signatures
and Station
Numbers

09/10/2023 Hobbs 1395.5 Tach 4079.93 TSPOH 96.93

Annual Inspection Completed: Inspected forward and aft bulkheads, dressed blades as required. All found to be satisfactory for service.

I Certify that this Propeller has been inspected in accordance with an Annual inspection and was determined to be in **Airworthy** condition.


James M. Chrestensen III
AP 3507385 IA

James M. Chrestensen III

Note: Enter Compliance With All Applicable FAA A.D. & Factory Service Bulletins On Pages 11 & 12

5

FREQUENCY - Hz

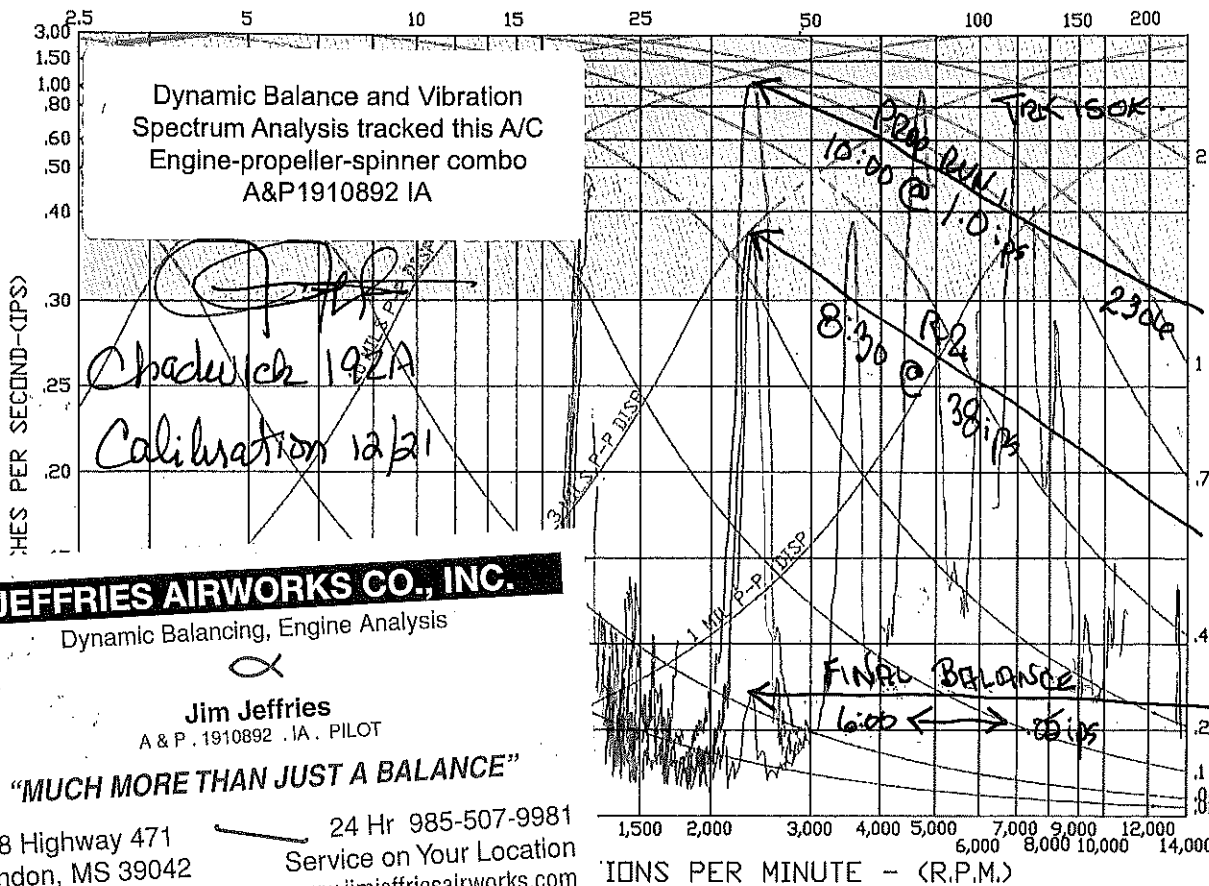

DATE 12-16-22
SUBJECT N-35 Bomanga
ID# N16764

LOCATION REMARKS

7:24
4020.06

VEL (IPS) X RPM
989°C
G

JEFFRIES AIRWORKS CO., INC.

Dynamic Balancing, Engine Analysis




Jim Jeffries
A & P, 1910892 IA, PILOT

"MUCH MORE THAN JUST A BALANCE"

1218 Highway 471
Brandon, MS 39042
jeffriesairworks@gmail.com

24 Hr 985-507-9981
Service on Your Location
www.jimjeffriesairworks.com

IONS PER MINUTE - (R.P.M.)

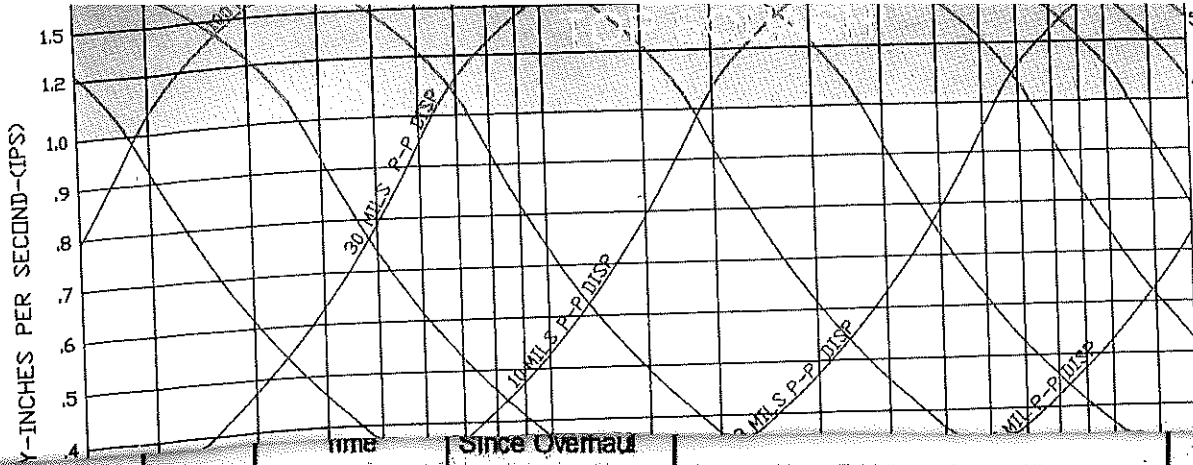

ACCELERATION-G
 VEL (IPS) X 19,000
 RPM
 LOCATION REMARKS

Time	Since Overhaul	Certificate Numbers
Date: 12/14/2024 Hours: AC TT 4135.35 TSO 152.35 Tail#: N18760 Make: McCauley Model: 3A32C76-S-QR S/N: 881373 This propeller has been inspected in conjunction with an annual inspection and is approved for return to service. David C Entrekin AP/IA 3398557 <i>[Signature]</i>		

Note: Enter Compliance With All Applicable FAA A.D. & Factory Service Bulletins On Pages 11 & 12